

CO Duett Coulter Assembly

After several thousand acres of use, some wear can appear on the Standard Tine assemblies fitted with either Duett or Delta coulters on the CO Airseeder range of drills.

The sign of the wear is excessive movement of the leg in a sideways or upward movement causing the sown bands of seed to merge together or leave big gaps between the bands along with inconsistent sowing depth. This is exaggerated in heavier soil conditions or direct drilling.

The wear occurs between the flipper (item no. 15 - Part no. 33645010) and the cast bottom plate (item no. 7 - Part no. 33645001). To overcome the wear a new design of retrofit flipper has been developed.

The benefits of the new flipper are:-

- Shank has to move on the pivot pin
- Improved trip force
- No sideways movement. The new flipper now clamps to the leg ensuring that the leg has to use the pivot pin, the old design did not.

The Part no. for the new style 'Flipper' is 96031500. Please note this part is only available as a retrofit part and is not fitted as standard to machines.

